② **PHOTO DETAIL**

GENERAL NOTES

ALL ABATEMENT RELATED ACTIVITIES AT THIS PROJECT SITE SHALL COMPLY WITH DIVISION 01 AND 02 AND SPECIFICALLY SECTION 028400 PCB ACTIVITIES. CONTRACTOR TO VERIFY ALL ITEMS SHOWN, LOCATIONS AND QUANTITIES OF MATERIALS TO BE REMOVED, AND DIMENSIONS PRIOR TO REMOVAL. ANY DEVIATIONS FROM THE SPECIFICATION THAT ARE DISCOVERED BY THE CONTRACTOR SHALL BE REPORTED TO THE OWNERS REPRESENTATIVE PRIOR TO REMOVAL. THE DRAWINGS ARE FOR DIAGRAMMATIC PURPOSES ONLY. GENERAL LOCATIONS OF PCB-CONTAINING MATERIALS ARE DEPICTED DIAGRAMMATICALLY ON THE DRAWINGS. THE REMAINING MATERIAL LOCATIONS ARE DESCRIBED TEXTUALLY ON THESE DRAWINGS. QUANTITIES OF HAZARDOUS MATERIALS LISTED ON THIS SHEET ARE CONSIDERED ACCURATE TO WITHIN +/- 10%. THE CONTRACTOR SHALL PROVIDE ALL LABOR, MATERIALS, EQUIPMENT AND PERMITS FOR THE REMOVAL AND DISPOSAL OF THE QUANTITIES OF HAZARDOUS MATERIALS PROVIDED PLUS AN ADDITIONAL 10%. THE CONTRACTOR WILL BE COMPENSATED FOR QUANTITIES WHICH ARE GREATER THAN 110% OF THE TOTAL AND THE OWNER WILL DEDUCT FROM THE CONTRACT SUM QUANTITIES THAT ARE 90% OR LESS OF THE TOTAL.

2. REMOVAL OF HAZARDOUS MATERIALS MAY COMPROMISE THE SECURITY OF THE SITE. THE CONTRACTOR IS FULLY RESPONSIBLE FOR MAINTAINING SITE SECURITY AND PUBLIC SAFETY THROUGHOUT THE PROJECT. SEE SPECIFICATIONS REGARDING SECURITY AND PUBLIC SAFETY.

3. ABATEMENT CONTRACTOR TO COORDINATE ALL ACTIVITIES WITH ALL OTHER ONSITE WORK INCLUDING, BUT NOT LIMITED TO: SCHEDULE, ACCESS, STAGING, ETC. ABATEMENT CONTRACTOR TO REPORT LOCATIONS AND QUANTITIES OF ALL HAZARDOUS
MATERIALS TO BE REMOVED, TO THE OWNERS REPRESENTATIVE PRIOR TO ABATEMENT/DEMOLITION.

4. THE CONTRACTOR SHALL REMOVE ALL ACCESSIBLE CAULKING IN ALL AREAS WITHOUT PERFORMING DEMOLITION OF BUILDING

KEY NOTES

REMOVE APPROX. 20 LF OF PCB-CONTAINING CAULKING LOCATED ON THE EXTERIOR AND INTERIOR METAL WINDOW FRAME ON THE GIRLS LOCKER ROOM NORTH PERIMETER WINDOW AS SHOWN.

REMOVE APPROX. 300 LF OF PCB-CONTAINING CAULKING ON THE EXTERIOR METAL WINDOW FRAMES ON ALL WINDOWS AT THE SOUTH AND WEST ELEVATIONS OF THE LARGE GYM BUILDING AS SHOWN. THIS INCLUDES CAULKING THAT EXISTS AROUND EACH WINDOW INFILL PANEL METAL FRAME TRANSITION ON THE WEST ELEVATION. THESE INFILL PANELS ARE CEMENT ASBESTOS

REMOVE APPROX. 40 LF OF PCB-CONTAINING CAULKING LOCATED ON INTERIOR SIDE OF THE THREE LOWER WINDOWS AND THE UPPER WINDOW BANK EAST VERTICAL IN THE GATHERING PLACE

AS SHOWN. REMOVE APPROX. 10 LF OF PCB-CONTAINING OF CAULK ON INTERIOR WINDOW FRAME VERTICALS IN THE CTE ROOM AS

REMOVE APPROX. 18 LF OF PCB-CONTAINING OF CAULK ON INTERIOR SIDE OF NORTH EXTERIOR GIRLS LOCKER ENTRY DOOR

REMOVE APPROX. 18 LF OF PCB-CONTAINING OF CAULK ON EXTERIOR SIDE OF NORTH CTE ENTRY DOOR AS SHOWN.

REMOVE APPROX. 18 LF OF PCB-CONTAINING OF CAULK ON THE INTERIOR SIDE OF THE NORTHWEST PERIMETER ENTRY DOOR FRAME OF THE SMALL GYM AS SHOWN.


REMOVE APPROX. 500 LF OF PCB-CONTAINING CAULKING LOCATED ON ALL VERTICAL STRUCTURAL METAL COLUMN TRANSITIONS THROUGHOUT THE EAST ELEVATION OF THE LARGE GYM AS SHOWN. THIS INCLUDES THE REMOVAL OF ALL CAULKING ON THE INTERIOR DEMISING WALL METAL BEAMS (VERTICAL AND HORIZONTAL) BETWEEN THE DAYCARE AND THE GATHERING PLACE/CAFETERIA AS SHOWN. THE CAULKING IS HEAVILY PAINTED

REMOVE APPROX. 780 LF OF PCB-CONTAINING CAULKING LOCATED ON ALL EXTERIOR VERTICAL STRUCTURAL METAL COLUMN TRANSITIONS THROUGHOUT THE LOWER WEST AND

THROUGHOUT THE WORK SCOPE AREA.

8 PHOTO DETAIL



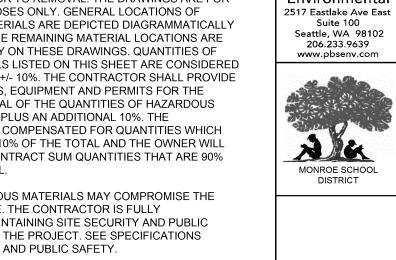

GYM BUILDING CAULKING ABATEMENT PLAN **EDUCATIONAL CENTER** SKY VALLEY I

PBS

Engineering +

Environmental


SKY VALLEY EDUCATIONAL CENTER 351 SHORT COLUMBIA STREET MONROE, WASHINGTON

PROJECT: 41373.000 JHD GM JUNE 2016 DWG NO. SHEET NO HM1 OF

EPA_001290

ED_001594_00087293


⊗PHOTO DETAIL

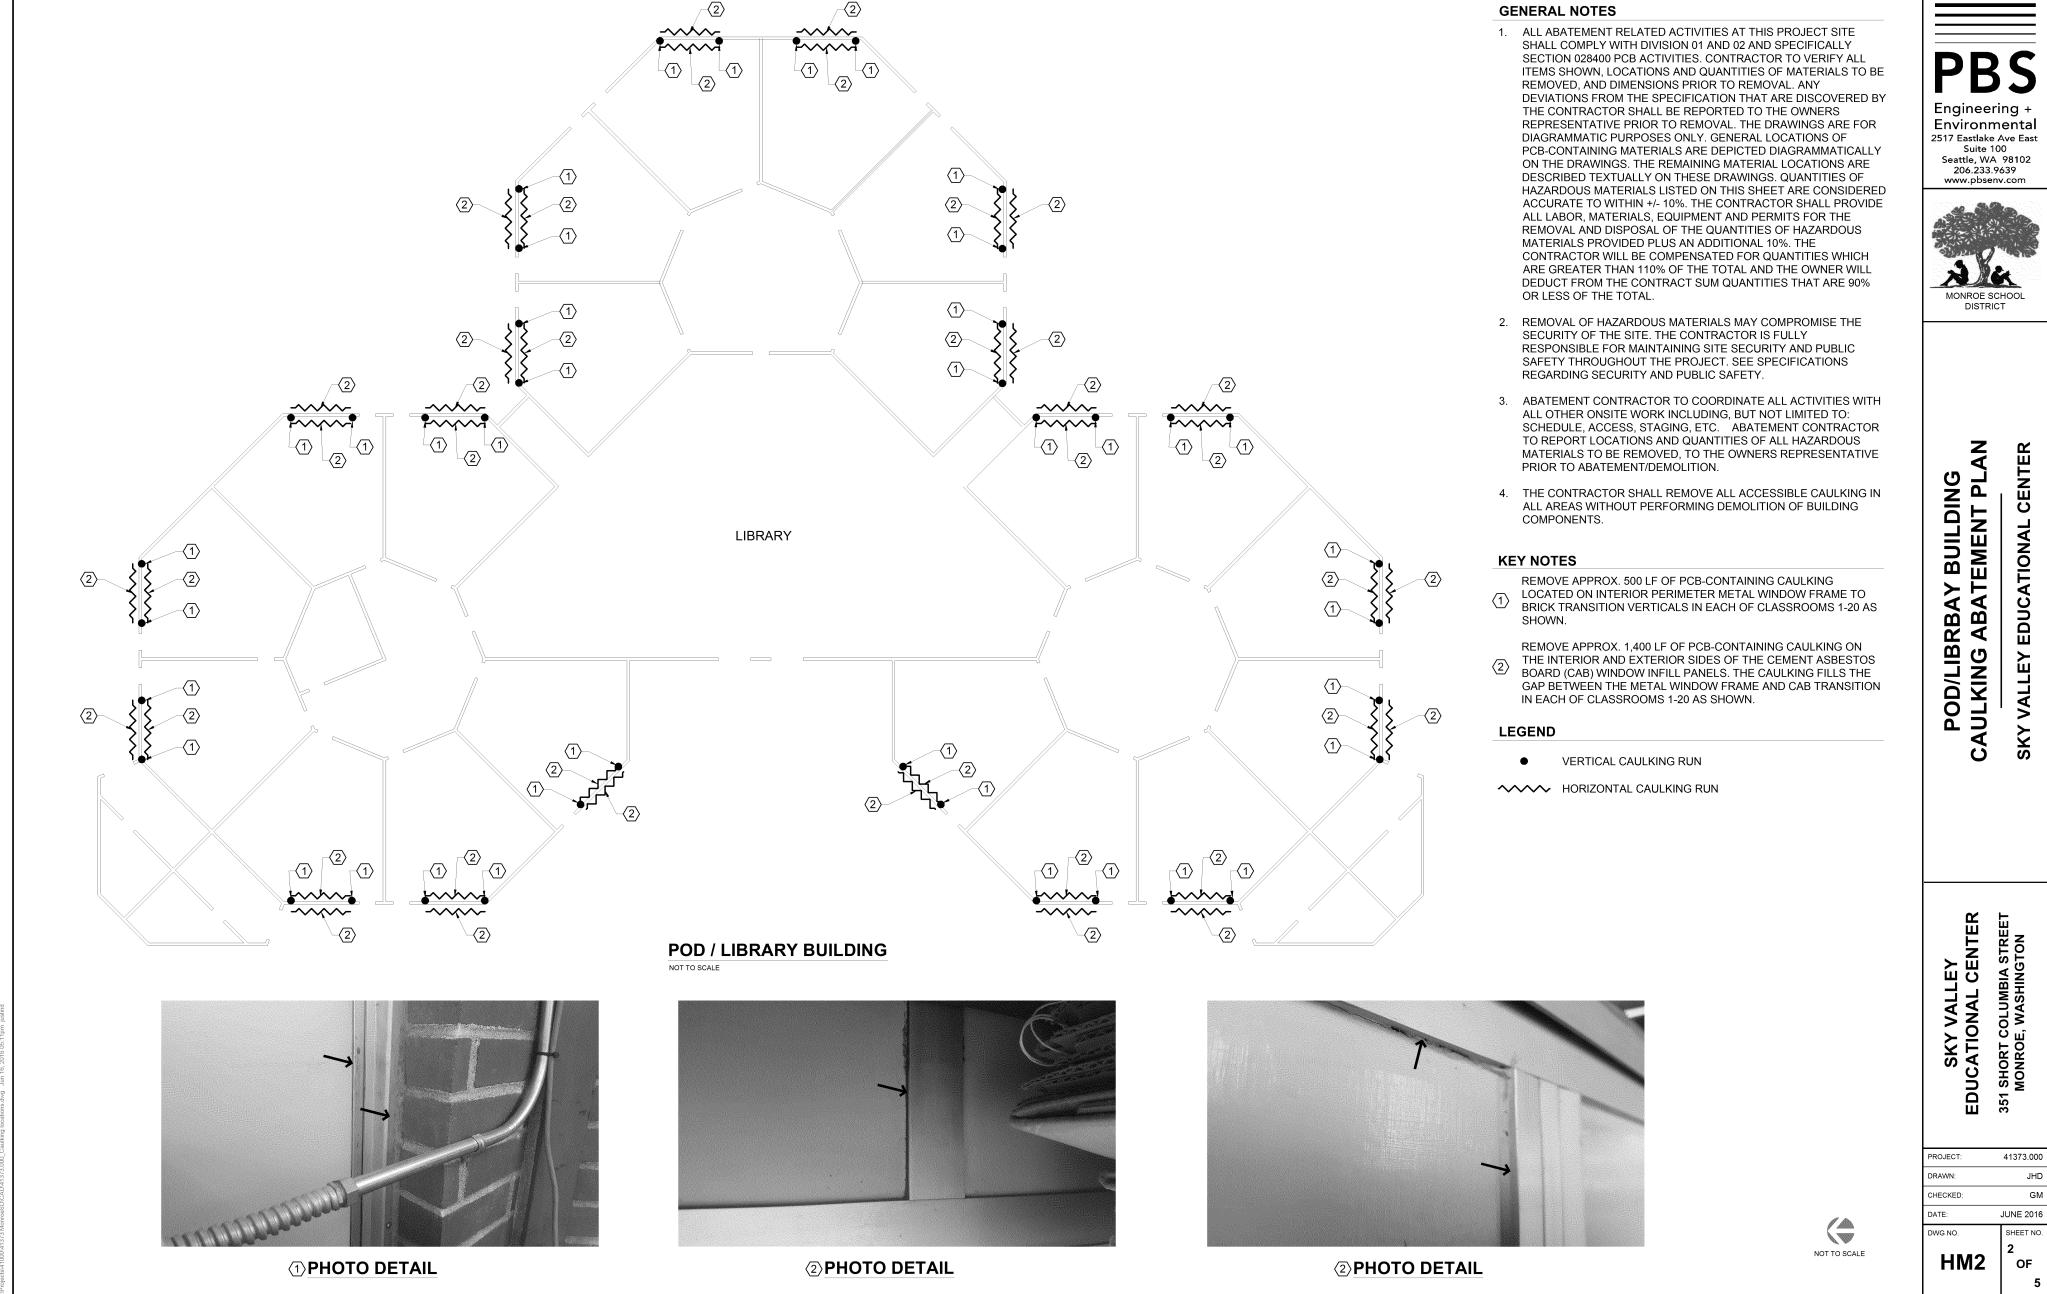


ED_001594_00087293

OF


EPA_001291

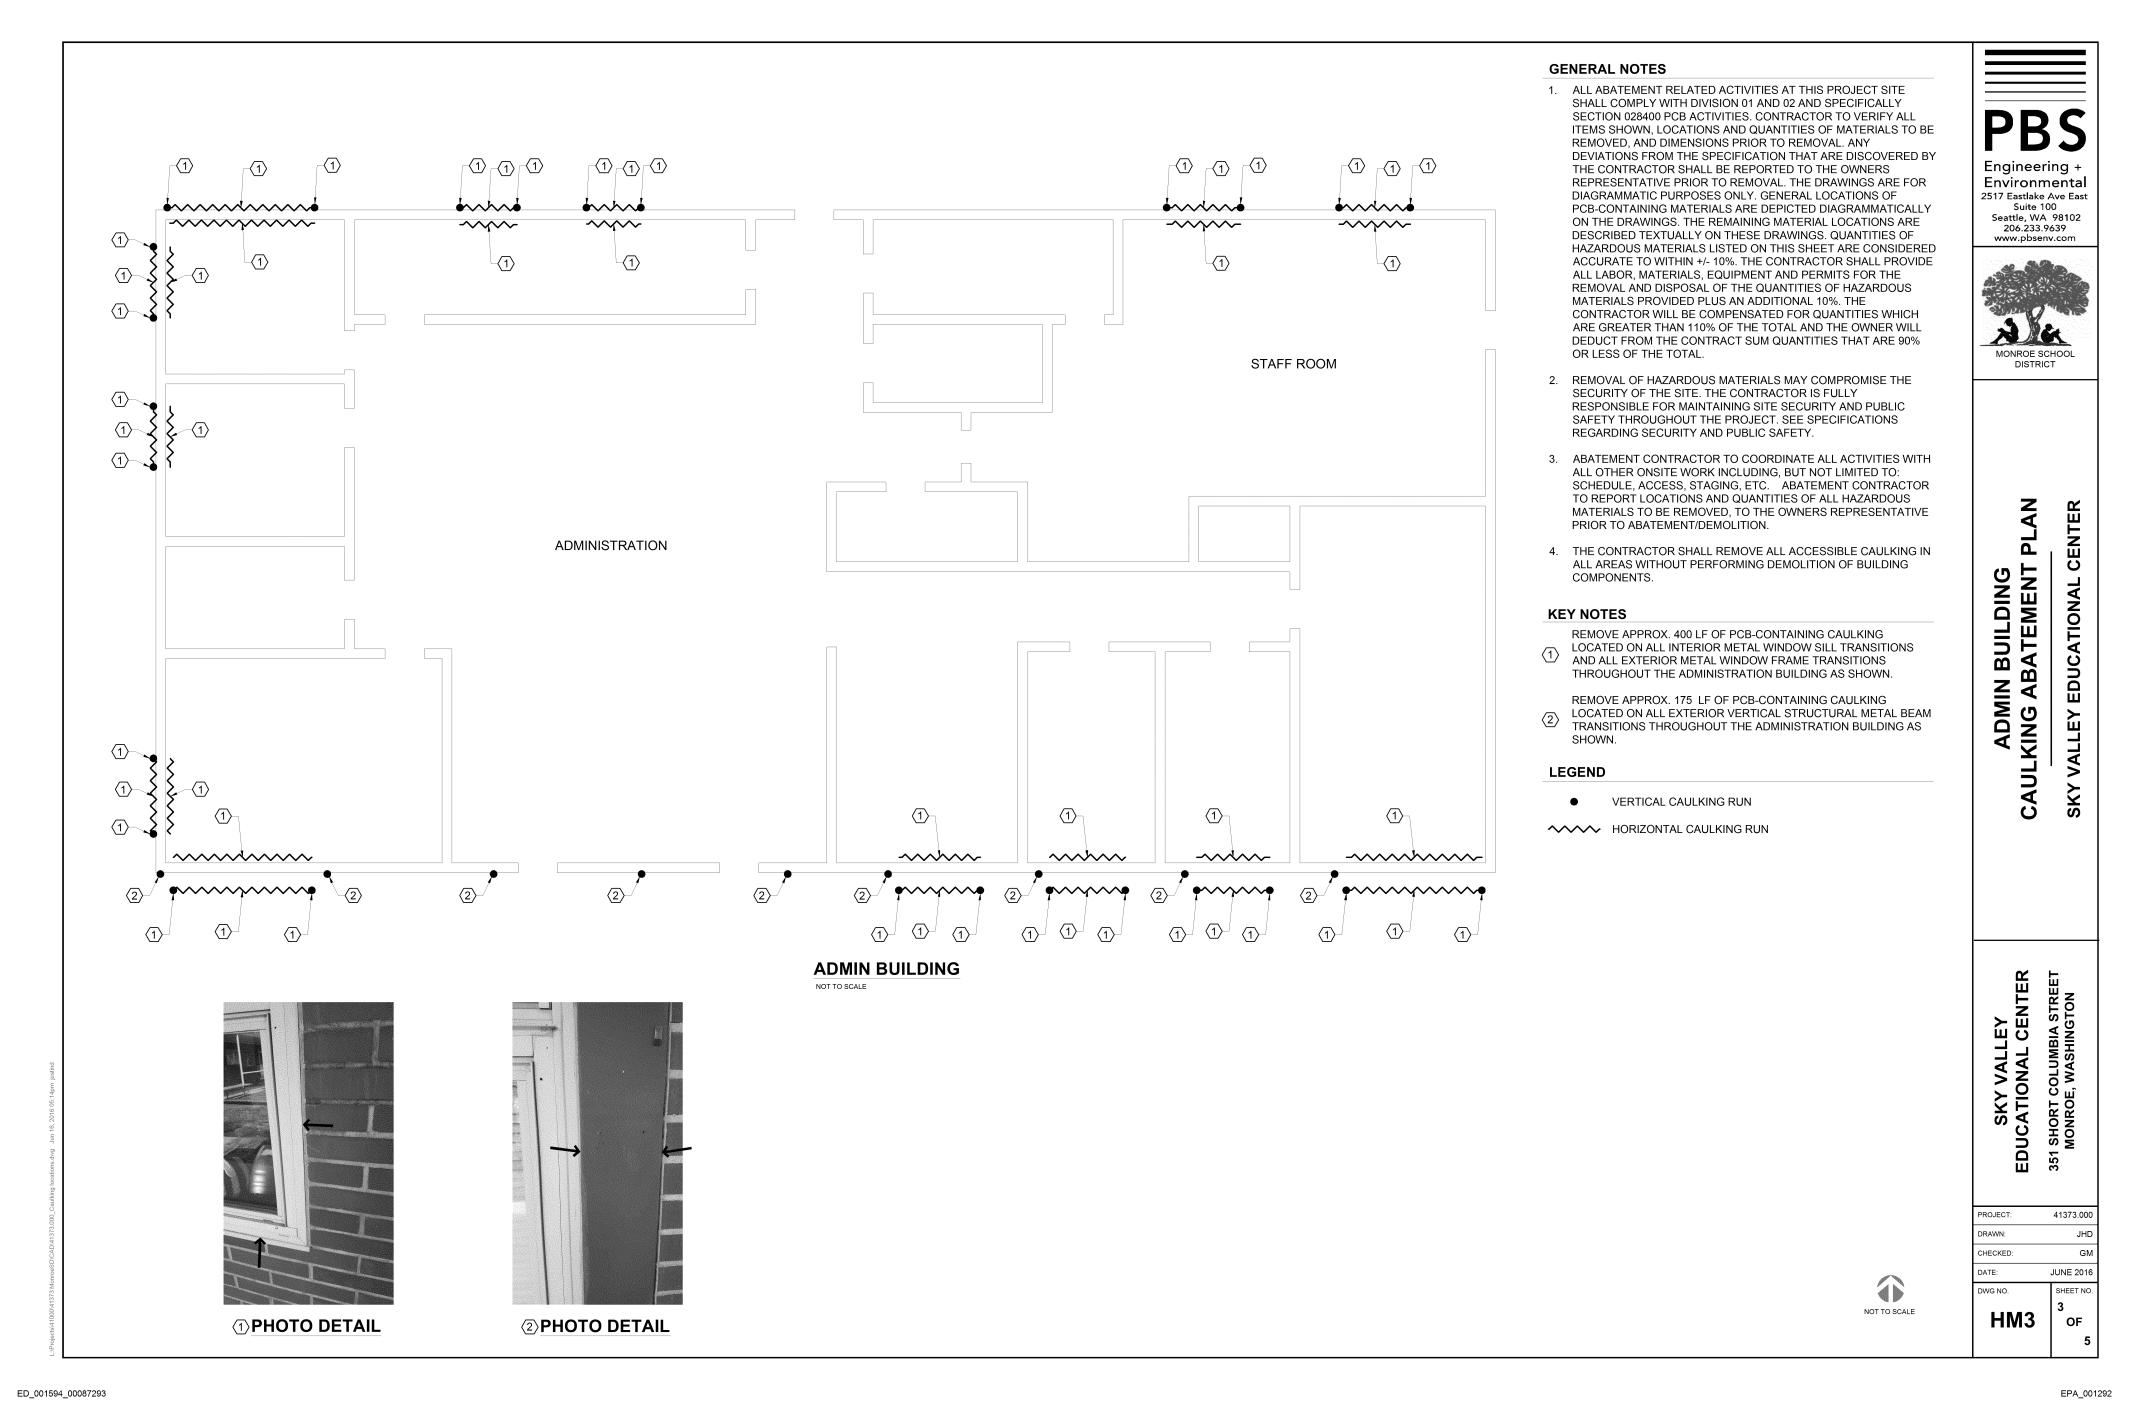

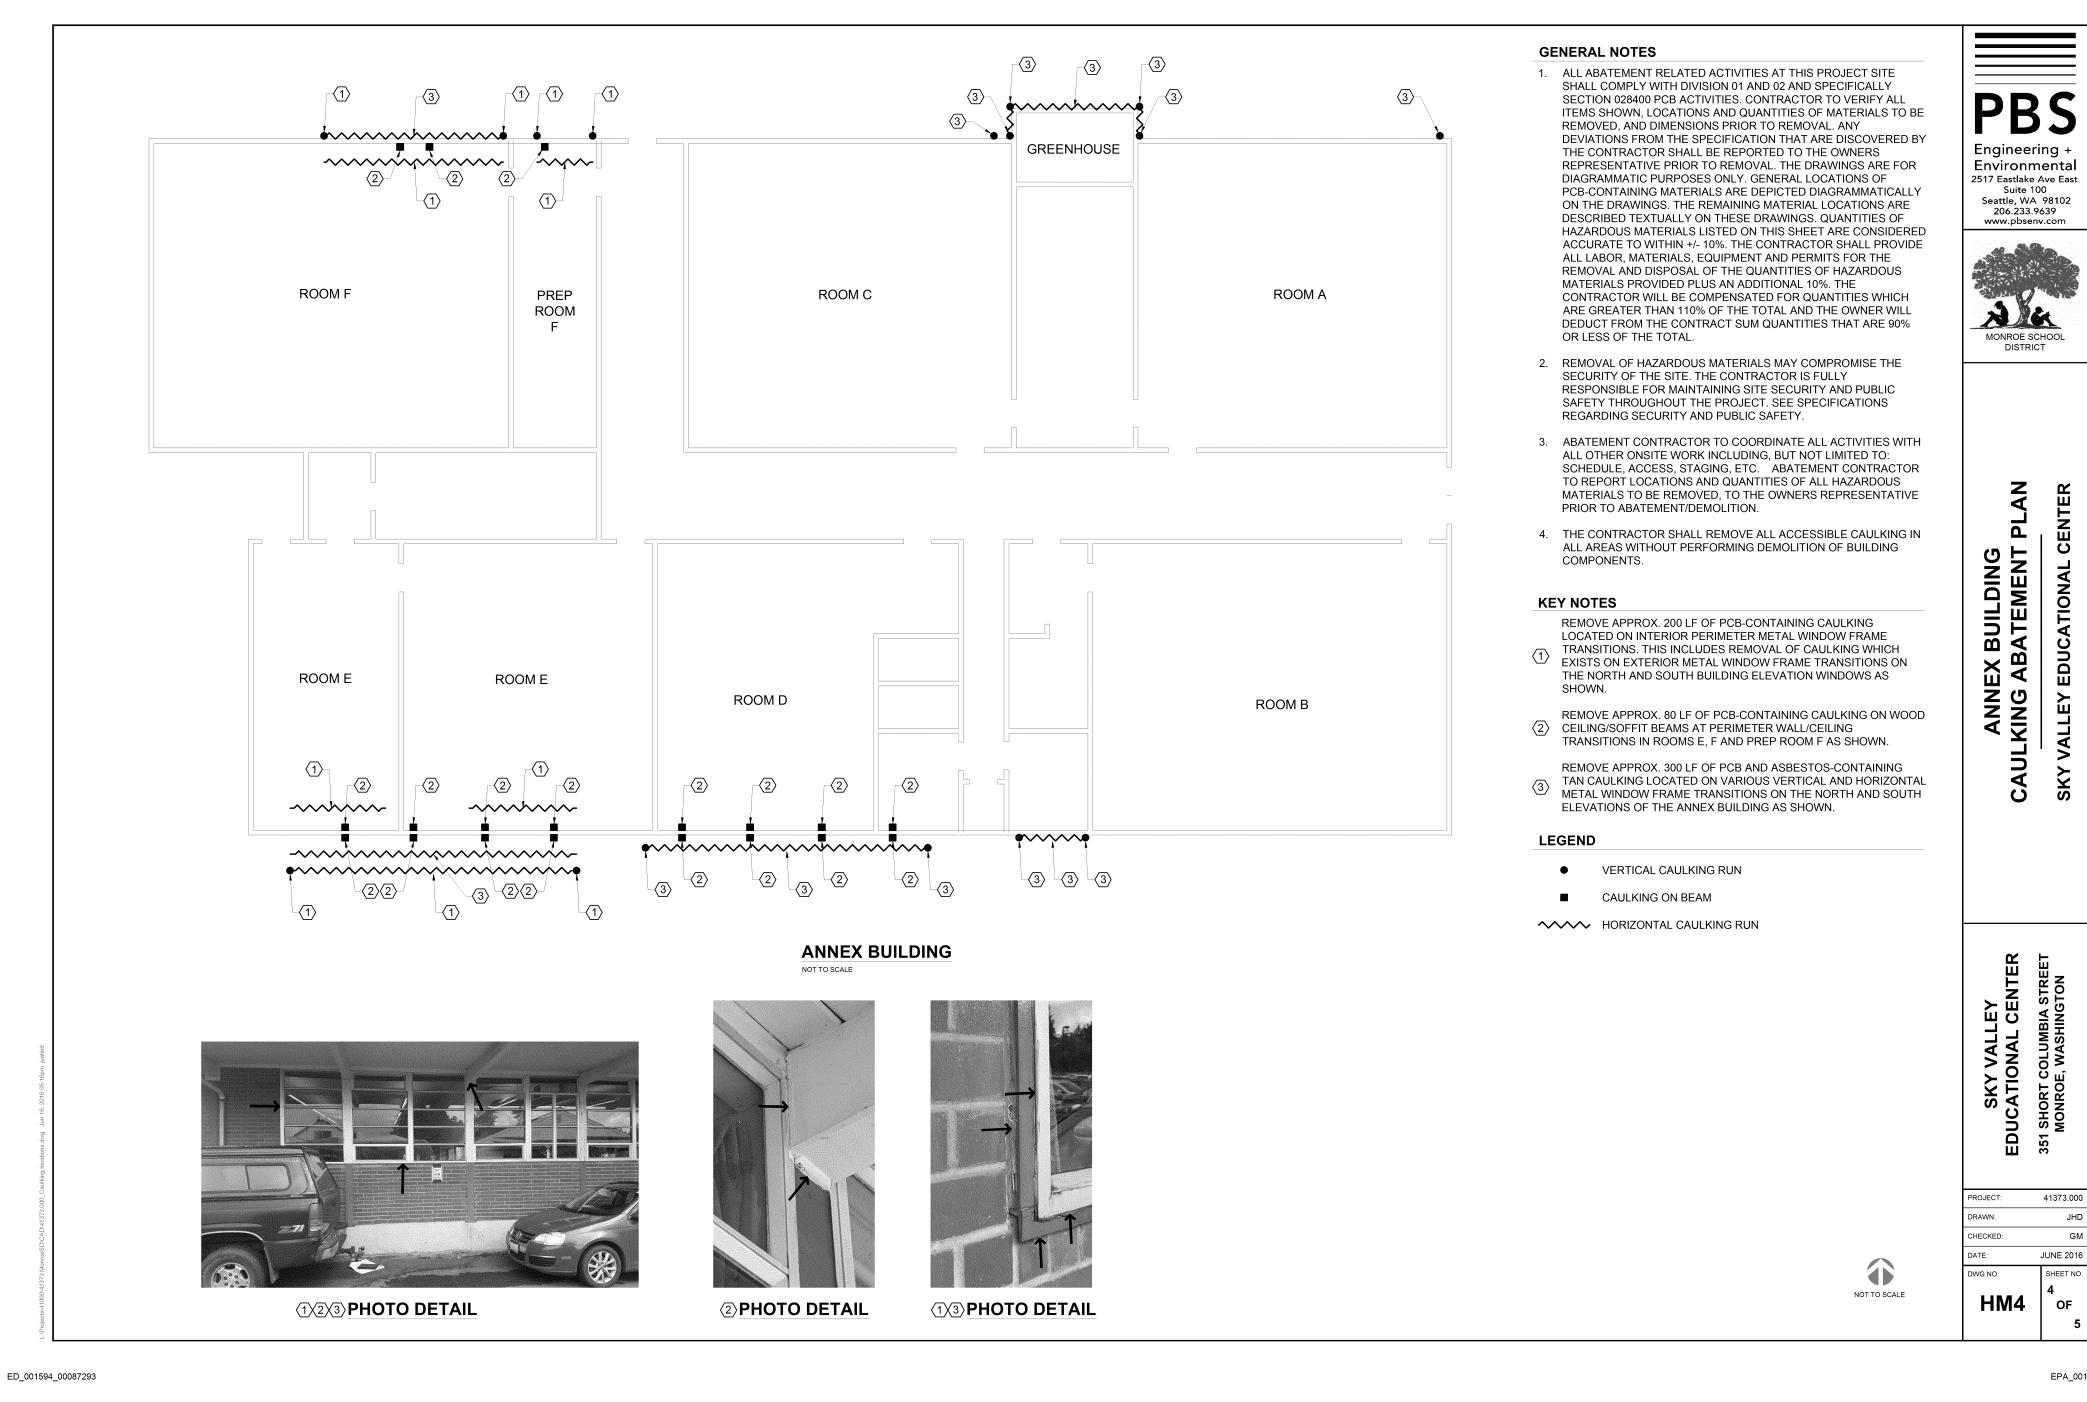

41373.000 JUNE 2016 SHEET NO

EPA_001293

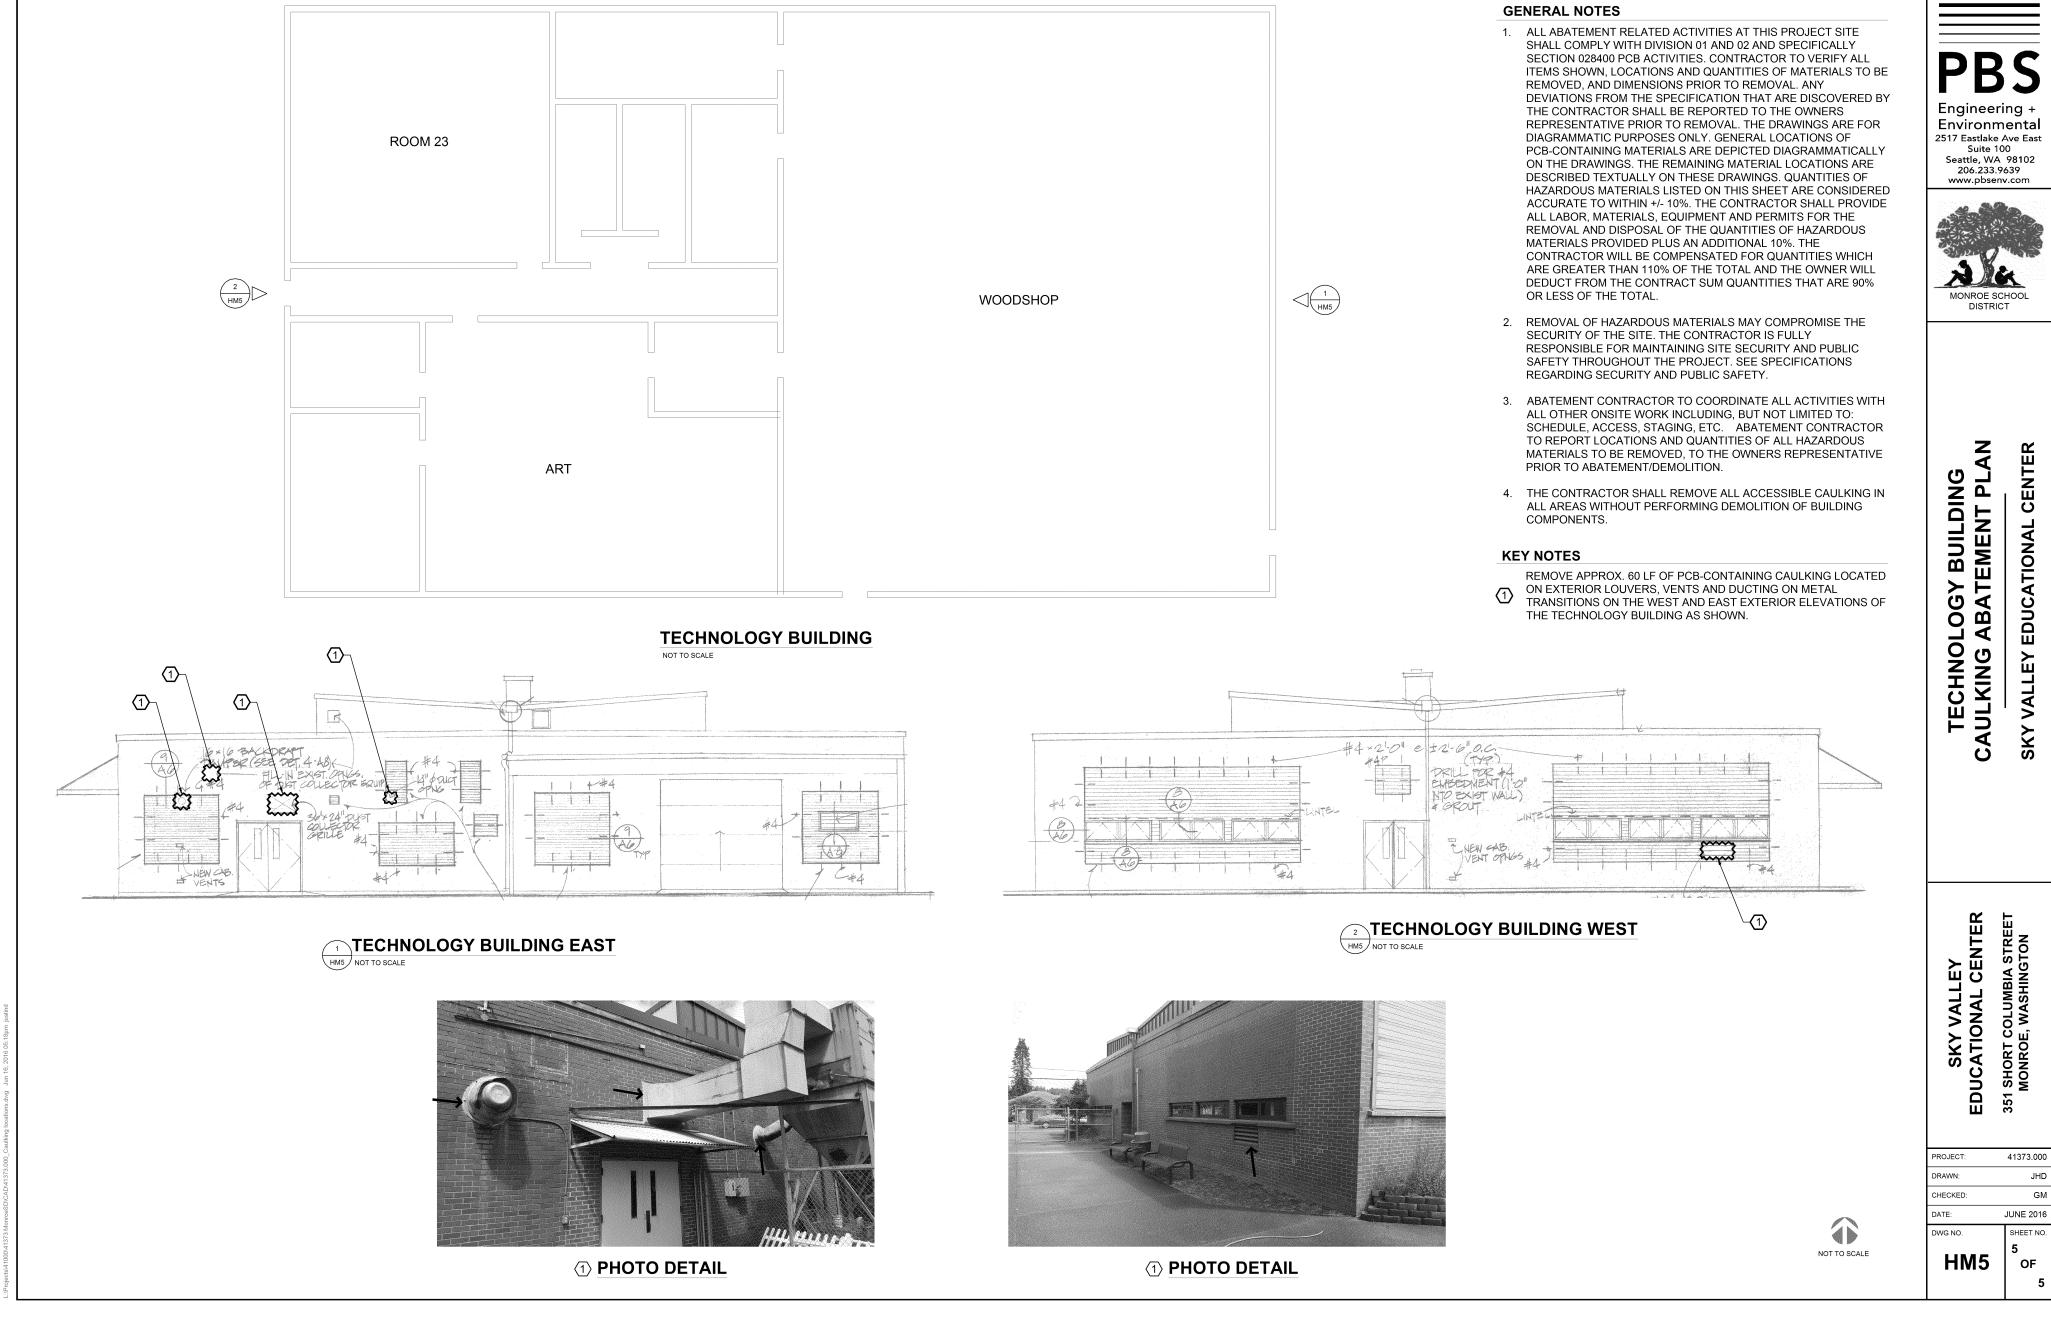

EPA_001294

ED_001594_00087293